



86 Constable Road, Felixstowe. IP11 7HW.

Tel: 01394 286129. Mob: 07843 188429

Company Number: 8855719

Felixstowe Town Council Tree Report


Report conducted by: Arrow Tree Services Ltd.

S.Cooper B.A. (Hons) NPTC UA5 Site Surveying Qualified

Introduction:

The following reports provide 'Tree Condition and Hazard Assessment' information for multiple sites in Felixstowe. These sites are as follows: **Cemetery Allotments, Cowpasture Allotments, Felixstowe Cemetery, Ferry Road Allotments, Railway Hill Allotments, Taunton Road Allotments and Peewit Hill.** There are approximately 280 individual trees within these sites. The reports provide information gathered from the visual inspection of these trees including: reference number as denoted on map, the tree species, categorisation of age, tree condition, observations, recommendations and the categorisation of the priority/urgency of remedial work potentially required.

I have endeavoured to keep the reports as clear and concise as possible only including the information directly relevant to the specification of the brief. I have provided this information based on the provision that the reader is suitably familiar with the various sites and assumed potential remedial work will be conducted by an applicably qualified individual or company.

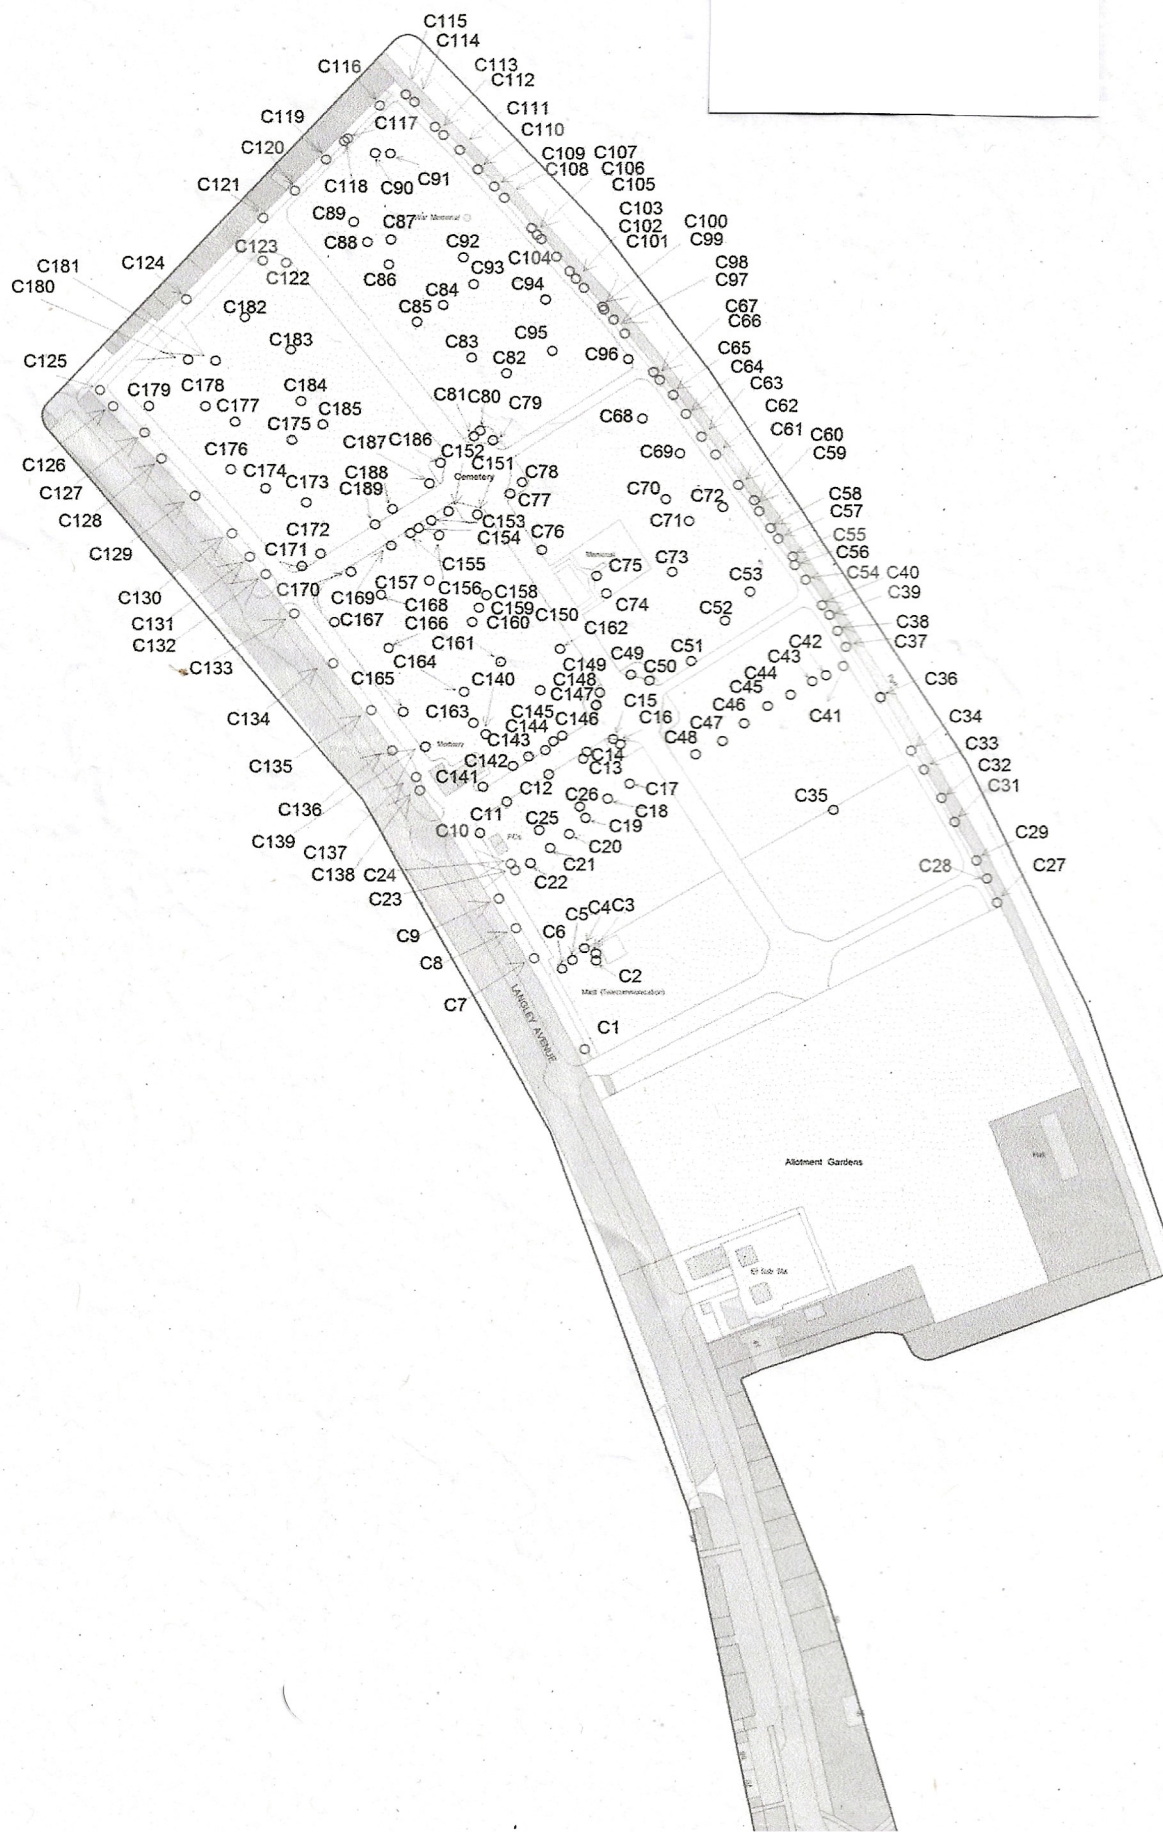

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
C2	Silver Birch	SM	G	NWR. Tree is in good health and contains minor dead wood.		
C3	Silver Birch	SM	G	NWR. Tree is in good health and contains minor dead wood.		
C6	REMOVED					
C7	London Plane	M	G	Tree is in good health. Recommend pruning branches away from BT wire which pass both sides of the tree canopy.	B	£75
C8	London Plane	M	G	Tree is in good health. Recommend pruning branches away from BT wire.	B	£40
C9	London Plane	M	G	Tree is in good health. Recommend pruning branches away from BT wire.	B	£40
C10	London Plane	M	G	NWR. Old pruning wounds visible on trunk & limbs.		
C11	Oak	SM	G	NWR.		
C12	Oak	SM	F	Minor dead wood present in mid-canopy, recommend removal.	B	£40
C13	Oak	SM	F	Minor dead wood present in mid-canopy, recommend removal.	B	£40
C14	REMOVED					
C15	Cherry	SM	F	NWR. Old pruning wounds are present. Peeling bark at base of trunk. Monitor condition of tree.		
C16	Cherry	Y	F	NWR.		
C17	Cherry	SM	G	Recommend crown lift to approximately 2.5m to provide pedestrian clearance.	A	£30
C18	Rowan	Y	G	NWR.		
C19	Rowan	Y	G	NWR.		
C20	Cherry	SM	P	Major crown die back present, prolific peeling bark on main trunk. Tree in severe decline therefore recommend removal.	A	£120
C21	Cherry	M	F	Exposed root system visible. Signs of decay present in trunk. Canopy contains over extended elongated limbs. Recommend monitor condition of tree.		
C22	REMOVED					
C23	Rowan	Y	G	NWR.		

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C24	Holly	SM	G	NWR.		
C25	Silver Birch	M	F	Cavities present in main trunk at approximately 6ft in height. Recommend monitor condition of tree.		
C26	Silver Birch	M	F	Main canopy has separated into large splayed 'Y' union. Recommend a crown reduction of approximately 30% to alleviate end heavy branch weight.	B	£180
C27	REMOVED					
C28	Norway Maple	M	G	NWR.		
C29	Rowan	Y	G	NWR.		
C30	Norway Maple	SM	G	NWR.		
C31	Norway Maple	SM	F	Major crack on compression fork of tree. The tree will inevitably continue to decline in health. Recommend removal.	B	£240
C32	Silver Birch	SM	G	NWR.		
C33	Norway Maple	SM	G	NWR. Monitor over hanging branches onto foot path.		
C34	Norway Maple	M	G	NWR.		
C35	X3 Pear Trees					
C36	Rowan	Y	F	NWR.		
C37	Silver Birch	SM	F	NWR.		
C38	Lawson Cypress	SM	G	NWR.		
C39	Lawson Cypress	SM	F	This tree is enveloped in dead Ivy as the Ivy has been 'banded' as some point to prevent further encroachment.		
C40	Cherry	SM	F	NWR.		
C41	Cherry	Y	G	NWR. This is a relatively new re-plant to replace a previously removed Cherry tree.		
C42	Cherry	M	G	Tree appears in good health. Recommend crown lift to approximately 2.5m over grave area to prevent low lying canopy interfering with pedestrians.	A	£40
C43	Rowan	SM	P	This tree is dead, recommend removal.	A	£60
C44	Cherry	M	G	Recommend cown lift approximately 2.5m over graves.	A	£40

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C45	Rowan	SM	F	NWR.		
C46	REMOVED					
C47	Rowan	SM	F	Tree appears in decline. Crown die back and peeling bark present. Recommend monitor condition.		
C48	Cherry	M	G	Recommend crown lift to approximately 2.5m over graves.		
C49	Cherry	SM	G	NWR.		
C50	Rowan	SM	G	Minor dead wood present in canopy, small cavities present in lower trunk. Recommend monitor condition.		
C51	Silver Birch	M	P	Major multiple cavities present, tree evidently in decline. Recommend removal as close proximity to graves.	A	£300
C52	Silver Birch	M	P	Severe crown die back present, tree evidently in decline. Recommend removal as close proximity to graves.	A	£220
C53	Silver Birch	M	F	NWR. Old pruning wounds visible.		
C54	Whitebeam	M	G	NWR. Crossed limbs present in crown, compressed union forks visible. Recommend monitor condition.		
C55	Silver Birch	SM	F	Tree is enveloped by Ivy currently covering 75% of trunk & canopy. Recommend Ivy banding & removal once dead.		
C56	Rowan	Y	F	Ivy present on trunk. Recommend band & remove.		
C57	Lawson Cypress	SM	F	NWR.		
C58	Lawson Cypress	SM	P	Enveloped by Ivy, crossed limbs & vertical columns present, peeling bark. Recommend removal.	A	£240
C59	Lawson Cypress	SM	F	NWR.		
C60	Oak	SM	G	NWR. Minor dead wood present in canopy.		
C61	Whitebeam	SM	G	NWR.		
C62	Whitebeam	SM	G	NWR.		
C63	Rowan	Y		NWR.		
C64	Laburnum	Y		NWR.		
C65	REMOVED					
C66	Cherry	F		NWR. Monitor overall condition.		

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C67	REMOVED					
C68	Silver Birch	M	P	Major crack/cavity in main trunk. Recommend removal.	A	£280
C69	Oak	SM	F	Large fracture crack present at approximately 10ft. Monitor tree condition as decay present.		
C70	Silver Birch	SM	P	Large cavity present at approximately 7ft. Recommend removal.	A	£300
C71	Chestnut	SM	G	Recommend crown lift over graves.	A	£30
C72	Chestnut	SM	G	Recommend crown lift over graves.	A	£30
C73	Chestnut	SM	G	Recommend crown lift over graves.	A	£30
C74	Whitebeam	SM	G	NWR.		
C75	Whitebeam	SM	G	NWR. Minor dead wood and crossed branches present.		
C76	Walnut	Y	P	NWR. Crown die back present, recommend monitor condition.		
C77	Silver Birch	SM	F	NWR.		
C78	Cherry	M	P	Tree is dead, therefore recommend removal.	A	£300
C79	Hawthorn	M	G	NWR.		
C80	REMOVED					
C81	Oak	SM	G	NWR.		
C82	Cherry	M	G	NWR.		
C83	Silver Birch	SM	G	NWR.		
C84	Silver Birch	M	G	NWR. Previously heavily pollarded due to storm damage.		
C85	Silver Birch	SM	F	Crown die back present. Recommend 30% crown reduction due to elongated limbs.	B	£90
C86	Cherry	M	G	Crown lift to approximately 2.5m over graves.	B	£40
C87	REMOVED					
C88	REMOVED					
C89	REMOVED					
C90	Maple	SM	G	NWR.		
C91	Cherry	SM	F	Cavity present at approximately 6ft. Recommend monitor condition of tree and assess spread of decay.		
C92	Silver Birch	SM	F	Crown lift to 2.5m over graves and reduce elongated limbs.	B	£120

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C93	Silver Birch	SM	P	Signs of decay in selected limbs. Recommend monitor condition of tree and assess.		
C94	Chestnut	M	G	Tree contains multiple crossed and rubbing branches. Recommend monitor condition of tree with a view to conducting a crown thinning operation when situation dictates.		
C95	Silver Birch	SM	P	This tree appears to be 'self-seeded' within the footprint of a bordered grave. Recommend removal to prevent potential damage and upheaval to grave.	A	£280
C96	Hawthorn	SM	G	NWR.		
C97	REMOVED					
C98	Cherry	SM	P	Ivy encroachment present, signs of crown die back. Recommend monitor condition.		
C99	REMOVED					
C100	Whitebeam	SM	G	Ivy encroachment at 75% of tree. Recommend Ivy removal to maintain health of tree.	B	£50
C101	Cherry	SM	P	Ivy enveloped and displaying signs of crown die back. Recommend banding Ivy and monitor tree condition.		
C102	Whitebeam	SM	G	NWR.		
C103	Hawthorn	SM	G	NWR.		
C104	Whitebeam	SM	G	NWR.		
C105	Cherry	SM	G	NWR.		
C106	Cherry	SM	G	NWR.		
C107	Cherry	SM	G	NWR.		
C108	Cherry	M	G	NWR.		
C109	Whitebeam	SM	G	NWR.		
C110	Leylandii	M	F	NWR. Slight yellowing of outer canopy. Recommend monitor condition.		
C111	Cherry	M	G	NWR.		
C112	Laburnum	Y	G	NWR.		

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature **SM** – Semi-mature **Y** – Young
CONDITION : G – Good **F** – Fair **P** - Poor **NWR** – No work required
PRIORITY: **A** – 2 months **B** – 18 months **C** – Within 2 years

C113	Leylandii	M	F	NWR.		
C114	Whitebeam	SM	G	NWR.		
C115	Whitebeam	SM	G	NWR.		
C116-C21	REMOVED			Replaced with Laurel hedging.		
C122	London Plane	M	F	Damage evident at base of trunk, signs of crown die back present. Recommend monitor tree condition.		
C123	REMOVED					
C124	REMOVED					
C125	London Plane	M	G	Branches over hang flats parking area and garden area. Recommend pruning canopy back to suitable clearance distance depending on response from residents.	B	£160
C126	London Plane	M	G	Recommend to crown lift over foot path.	B	£30
C127	London Plane	M	G	Recommend to crown lift over foot path.	B	£30
C128	Hawthorn	Y	G	NWR.		
C129	Silver Birch	SM	F	Rot pocket visible at main 'Y' union. Monitor condition.		
C130	London Plane	M	G	Crown Lift over path & road.	B	£30
C131	London Plane	M	G	Crown lift over path & road. Dead wood is present mid canopy, recommend removal.	B	£45
C132	London Plane	M	G	Crown lift over path & road.	B	£30
C133	London Plane	M	G	Recommend removal of Ivy on main trunk to halt further encroachment.		
C134	Group in line: x1 Oak, x3 Cherries, x1 Conifer.	SM	F	NWR.		
C135	Cherry	M	G	NWR.		
C136	Chestnut	SM	G	NWR.		
C137	Lime	SM	G			
C138	X2 Hollies	SM	G	Recommend to prune back from BT line.	B	£40

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C139	Whitebeam	M	G	Monitor compression forks on vertical stems & crossed branches.		
C140	Whitebeam	M	G	Monitor compression forks on vertical stems & crossed branches.		
C141	Rowan	Y	F	NWR.		
C142	Sycamore	SM	G	NWR.		
C143	Sycamore	SM	G	NWR.		
C144	Oak	SM	G	NWR.		
C145	Twin Stemmed Oak	SM	G	Contains a medium amount of dead wood due to shading on sun light. Monitor & remove dead wood.		
C146	Oak	SM	G	Canopy contains minor dead wood.		
C147	Silver Birch	M	F	Cavities present in upper canopy. Very 'splayed' over extended upper crown. Recommend crown reduction to re-distribute weight.	B	£150
C148	Silver Birch/Rowan	SM	G	The trunks of these trees have become wedged together at ground level. Recommend monitoring the condition as the trees are in competition with each other for trunk girth expansion.		
C149	Cherry	SM	G	NWR.		
C150	REMOVED					
C151	Silver Birch	M	G			
C152	Oak	Y	F			
C153	X2 Laburnums	M	F	Has been heavily pollarded in the past, cavities & fungus present. Recommend to monitor condition.		
C154	X2 Cherries	SM	F	Minor dead wood present.		
C155	Oak	SM	F	Minor dead wood present. Very 'cluttered' canopy from regenerative growth from old pruning cuts.		
C156	REMOVED					
C157	Silver Birch	M	F	Canopy contains over extended 'end heavy' limbs. Recommend to monitor condition with a view to a crown reduction when the situation dictates.		
C158	Silver Birch	M	F	Small cavities present on trunk and limbs. Recommend to monitor condition and assess spread of decay.		

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P - Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

C159	Plum	SM	F	This tree has a heavy lean at base level due shading caused by close proximity to Silver Birch.		
C160	Whitebeam	M	G	Minor dead wood present in canopy.		
C161	Walnut	M	G	Cankers present in lower trunk. Recommend monitoring sap bleeding from cankers and assess tree health.		
C162	Silver Birch	M	G	NWR.		
C162a	Silver Birch	SM	P	Major fracture present at main fork union. Recommend removal.	A	£270
C163	Oak	SM	G	Recommend minor crown lift over graves.	B	£40
C164	Silver Birch	M	F	Minor dead wood present in canopy.		
C165	Oak	SM	F	Minor dead wood present in upper canopy.		
C166	Silver Birch	M	F	Cavities present, crack damage and decay present in upper limbs. Recommend monitor tree condition.		
C167	Cherry	SM	G	NWR.		
C168	Whitebeam	SM	G	NWR.		
C169	X2 Hawthorns	Y	G	NWR.		
C170	Laburnum	M	F	Previously heavily pollarded. Rot pockets present and signs of peeling bark. Tree appears to be in decline, recommend to monitor condition.		
C171	Laburnum	M	P	Previously heavily pollarded. Multiple pruning wounds present.		
C173	Laburnum	M	F	Previously heavily pollarded. Multiple pruning wounds present.		
C174	Cherry	SM	F	Monitor basal compression forks as peeling bark present.		
C175	Cherry	M	F	Sap bleeding from old pruning wounds, monitor trunk cavities. Recommend to crown lift over grave areas.	B	£30
C176	Twin stem Cherry	Y	P	This tree is growing from a grave template and has a very sparse canopy. Recommend removal.	B	£120
C177	Rowan	Y	F	NWR.		
C178	Apple	SM	G	NWR.		
C179	Silver Birch	SM	G	NWR.		
C180	Rowan	SM	G	NWR.		

FELIXSTOWE MAIN CEMETERY -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021


AGE CLASS: M – Mature SM – Semi-mature Y – Young

CONDITION : G – Good F – Fair P - Poor NWR – No work required

PRIORITY: A – 2 months B – 18 months C – Within 2 years

C181	Rowan	Y	P	Tree in severe decline. Recommend removal.	A	£30
C182	Cherry	M	P	Tree in decline & displaying signs of disease. Monitor & assess with a view to removal.		
C183	Cherry	M	F	Canopy contains over extended limbs. Monitor with a view to a crown reduction when situation dictates.		
C184	Silver Birch	SM	G	Minor dead wood present in canopy.		
C185	Rowan	Y	P	Tree id dead. Recommend removal.	A	£30
C186	Silver Birch	SM	G	NWR.		
C187	Oak	SM	G	NWR.		
C188	Laburnum	M	F	Tree has been previously heavily pollarded. Contains numerous pruning wounds. Recommend monitor condition.		
C189	X2 Oaks	SM	G	NWR.		


Mast (Telecommunication)

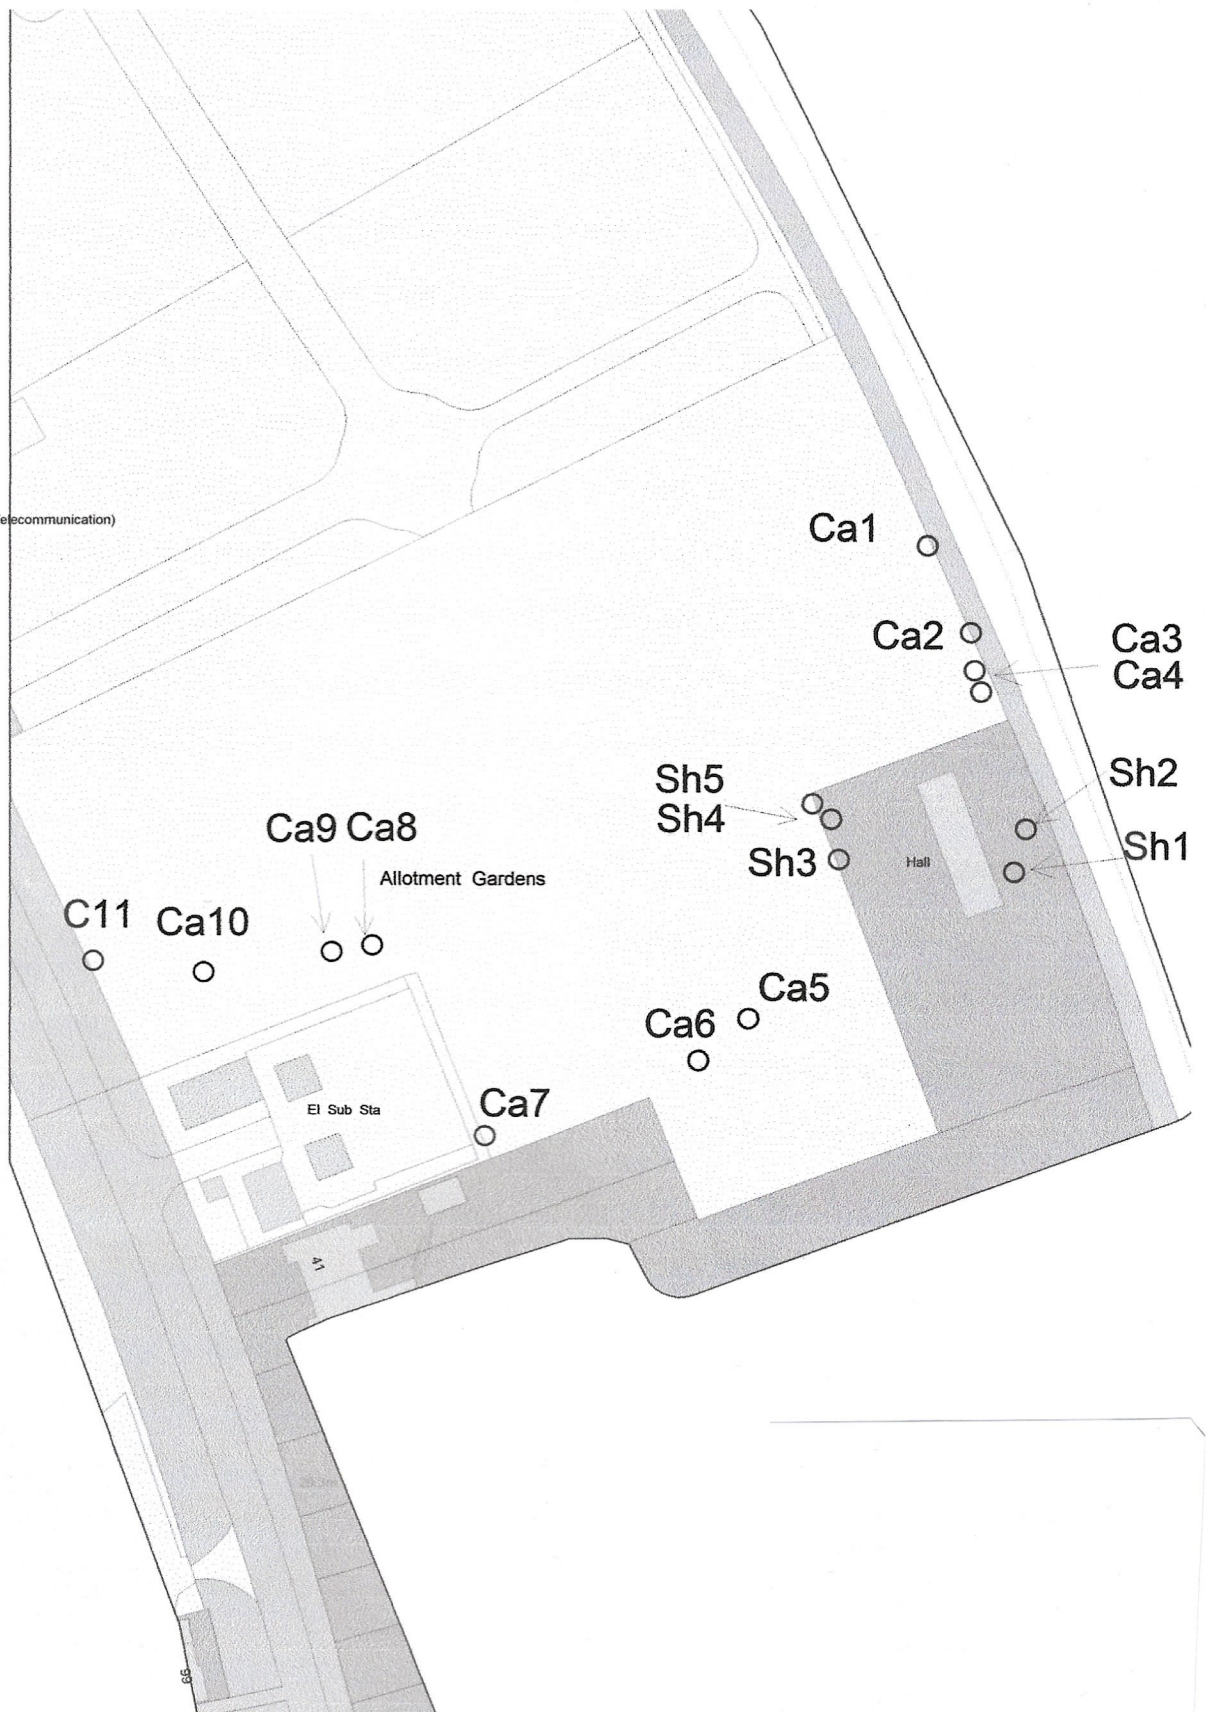

FELIXSTOWE CEMETERY ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years


REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
CA1	Sycamore	SM	F	NWR.		
CA2	Sycamore	SM	F	NWR.		
CA3	Sycamore	SM	F	NWR.		
CA4	Sycamore	SM	F	NWR.		
CA5	Silver Birch	Y	G	NWR.		
CA6	Holly	Y	F	Enveloped in Ivy, recommend removal of Ivy before tree is entirely engulfed.	B	
CA7	Rowan	Y	G	NWR.		
CA8	Elder	Y	P	Enveloped with bramble and vine, recommend removal before tree is entirely engulfed.	B	
CA9	Holm Oak	M	G	NWR.		
CA10	REMOVED					
CA11	REMOVED					
SH1	Sycamore	M	F	NWR.		
SH2	Sycamore	M	F	NWR.		
SH3	Oak	SM	F	NWR. Minor dead wood present in canopy.		
SH4	Oak	SM	F	NWR. Minor dead wood present in canopy.		
SH5	REMOVED					

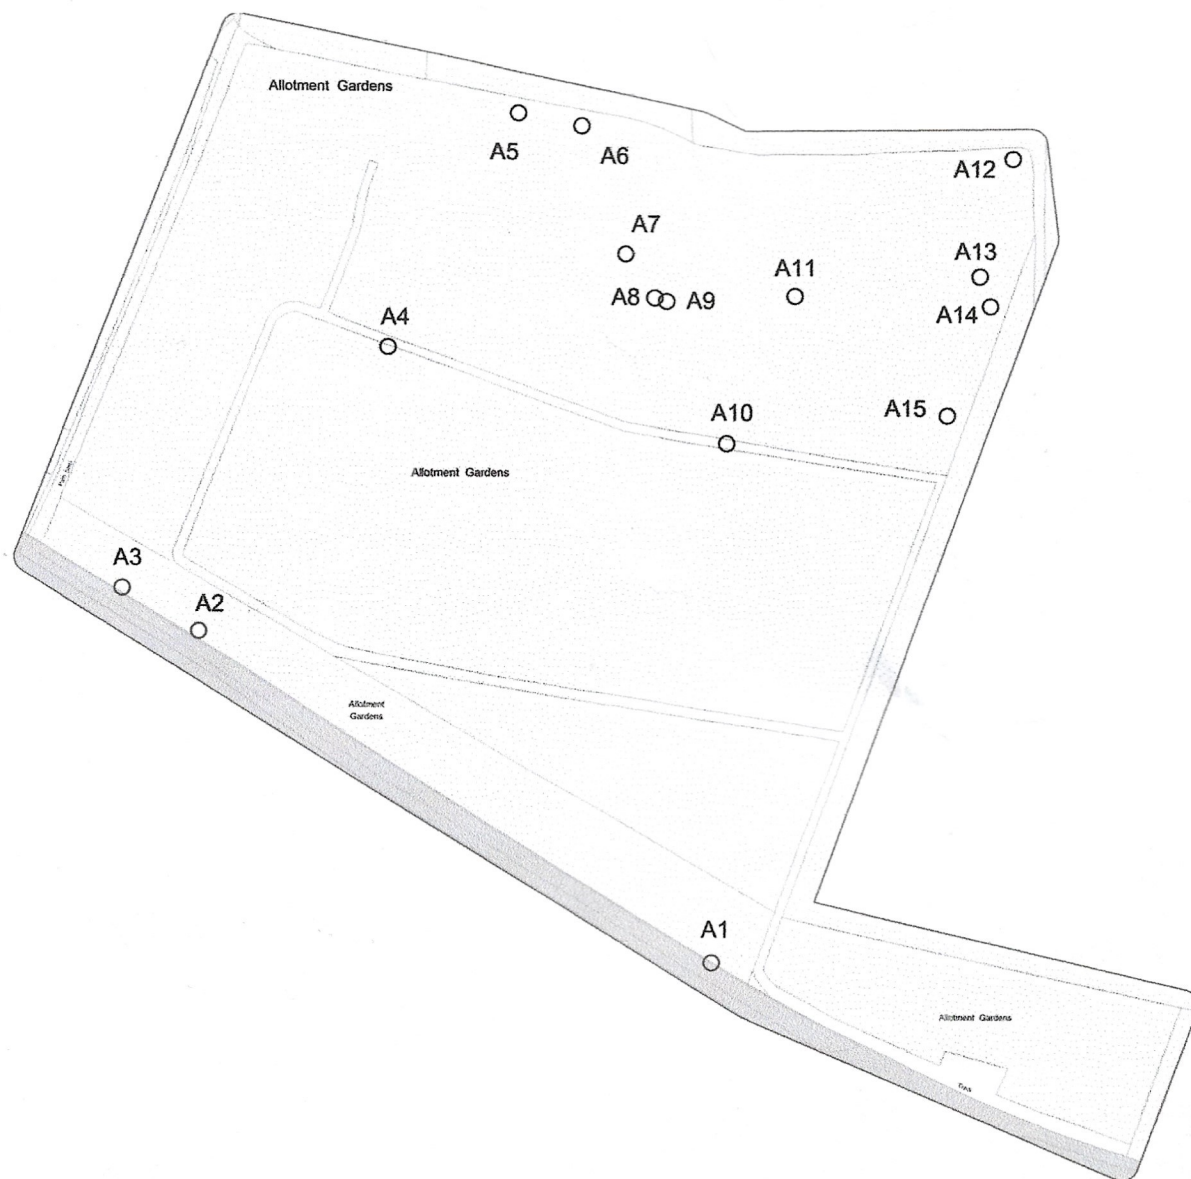

COWPASTURE ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years


REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
A1	REMOVED					
A2	REMOVED					
A3	Ash	SM	F	NWR. Extensive pruning wounds present.		
A4	Apple	SM	P	Crown die back present, tight basal union fork present & dead wood in canopy. Recommend 50% reduction.	B	£60
A5	Cherry	Y	F	NWR. Tree has been previously pruned and maintained.		
A6	Oak	M	F	NWR. Contains minor dead wood. The canopy over hangs a bird aviary.		
A7	Cypress (Group)	Y	G	NWR.		
A8	REMOVED					
A9	Cherry Laurel	SM	G	NWR.		
A10	Hazel (Group)	Y	G	May need to be pruned with regards to access. Monitor growth.		
A11	Common Pear	SM	G			
A12	Lombardy Poplar	M	G	Irregular trunk formation. Monitor basal unions for potential splintering		
A13	Fruit trees (Group)	SM	G-P	This group contains 9 trees in total, 3 of which are dead. Recommend removal of dead trees.	A	£300
A14	Ash	M	F	80% of this tree is covered with Ivy. Numerous bad pruning cuts are visible. Recommend banding Ivy at base to preserve the health of the tree.	B	
A15	Cherry	SM	P	This tree is predominately dead and as a result should be removed. It over hangs various sheds and poly tunnels so will have to be sectionally dismantled.	A	£200

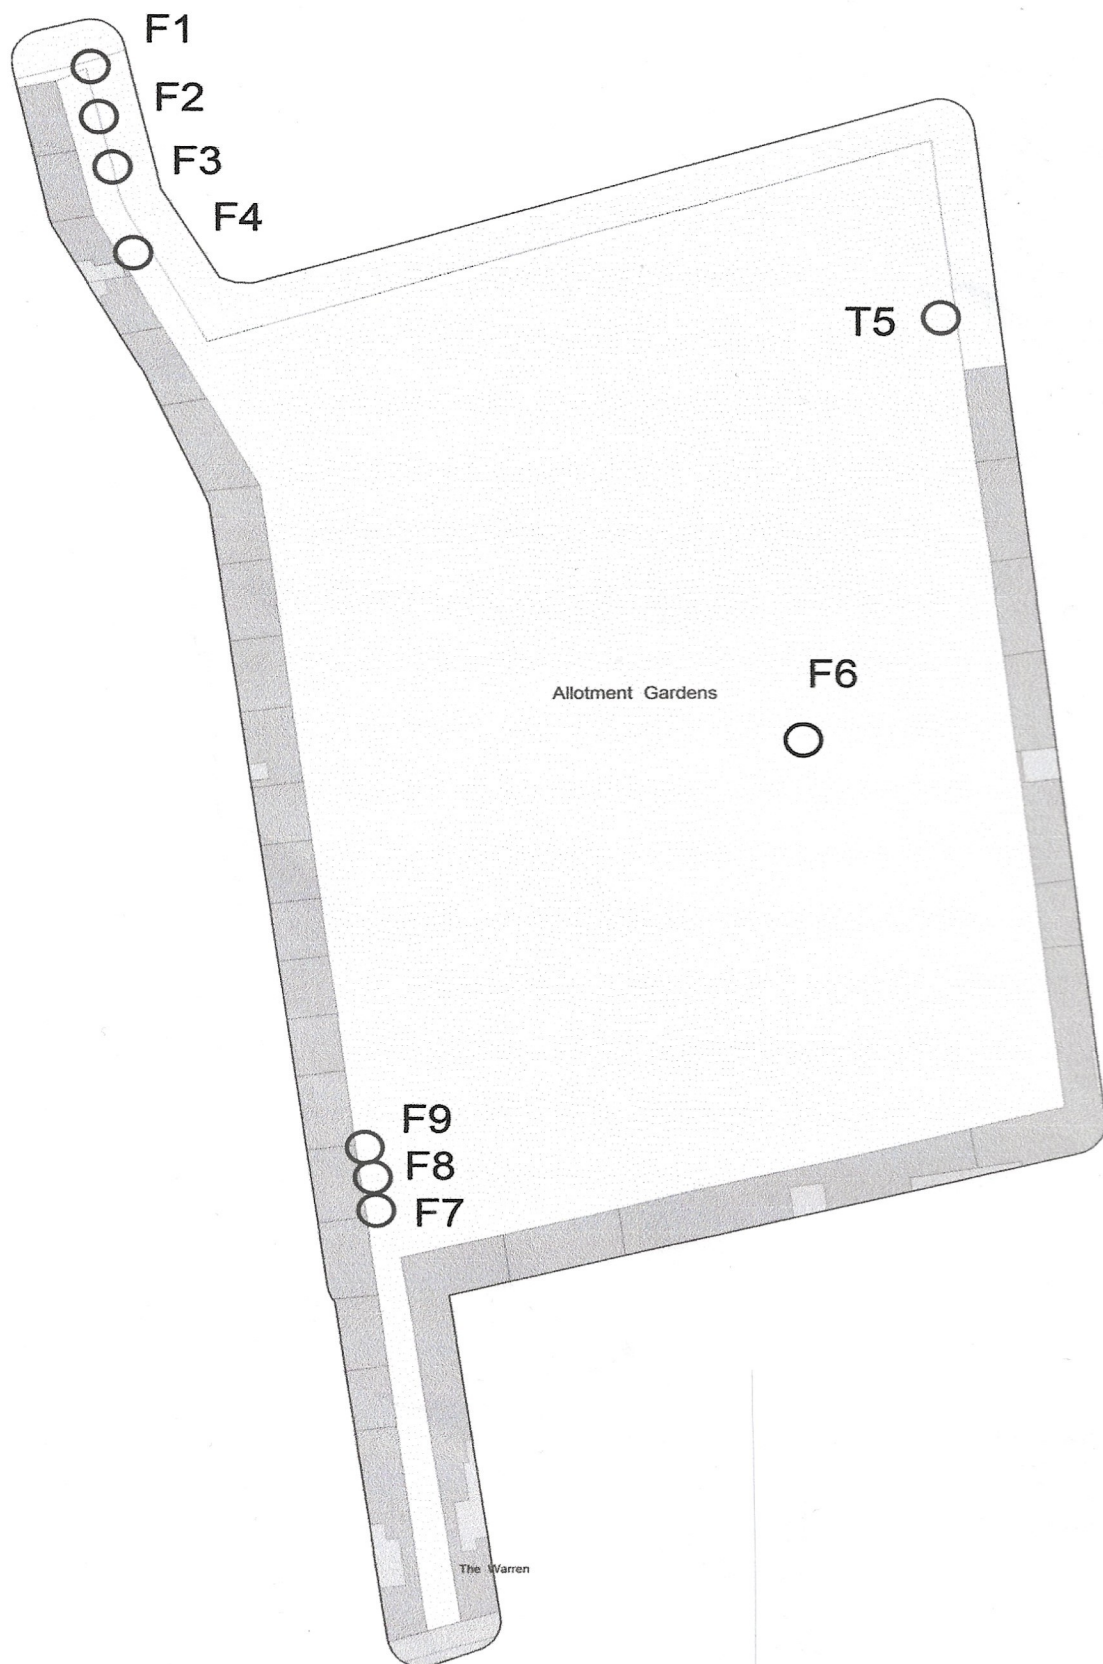

FERRY ROAD ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years


REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
F1	Ash	M	G	F1,F2 & F3 are in extremely close proximity to a new build house. The regenerative growth from side pruning is now practically in contact with the walls and roof of residency. Recommend monitoring tree condition as these trees will inevitably cause a problem and potential damage to the new build.	B	
F2	Pin Oak	M	G	See above.		
F3	Pin Oak	M	G	See above.		
F4	Hawthorn	M	G	Over hanging residential gardens & sheds from Ferry Road properties. Recommend monitoring tree condition as this problem will inevitably increase as the tree continues to grow in size.		
F5	Plum	SM	F	This tree leans heavily and over hangs allotment sheds. Recommend monitoring tree condition with a view to reducing the crown of the potential removal of the tree when the situation dictates.	B	
F6	Walnut	SM	P	Has been previously pollarded to a height of approximately 6ft. The tree is in severe decline. Recommend monitoring tree condition with a view to its potential removal.		
F7	Holm Oak	Y	G	A new fence has been installed along the allotment boundary. F7, F8 & F9 are now incorporated into the rear gardens of residential properties on Ferry Road.		
F8	Holm Oak	SM	G	See above.		
F9	Holm Oak	SM	G	See above.		

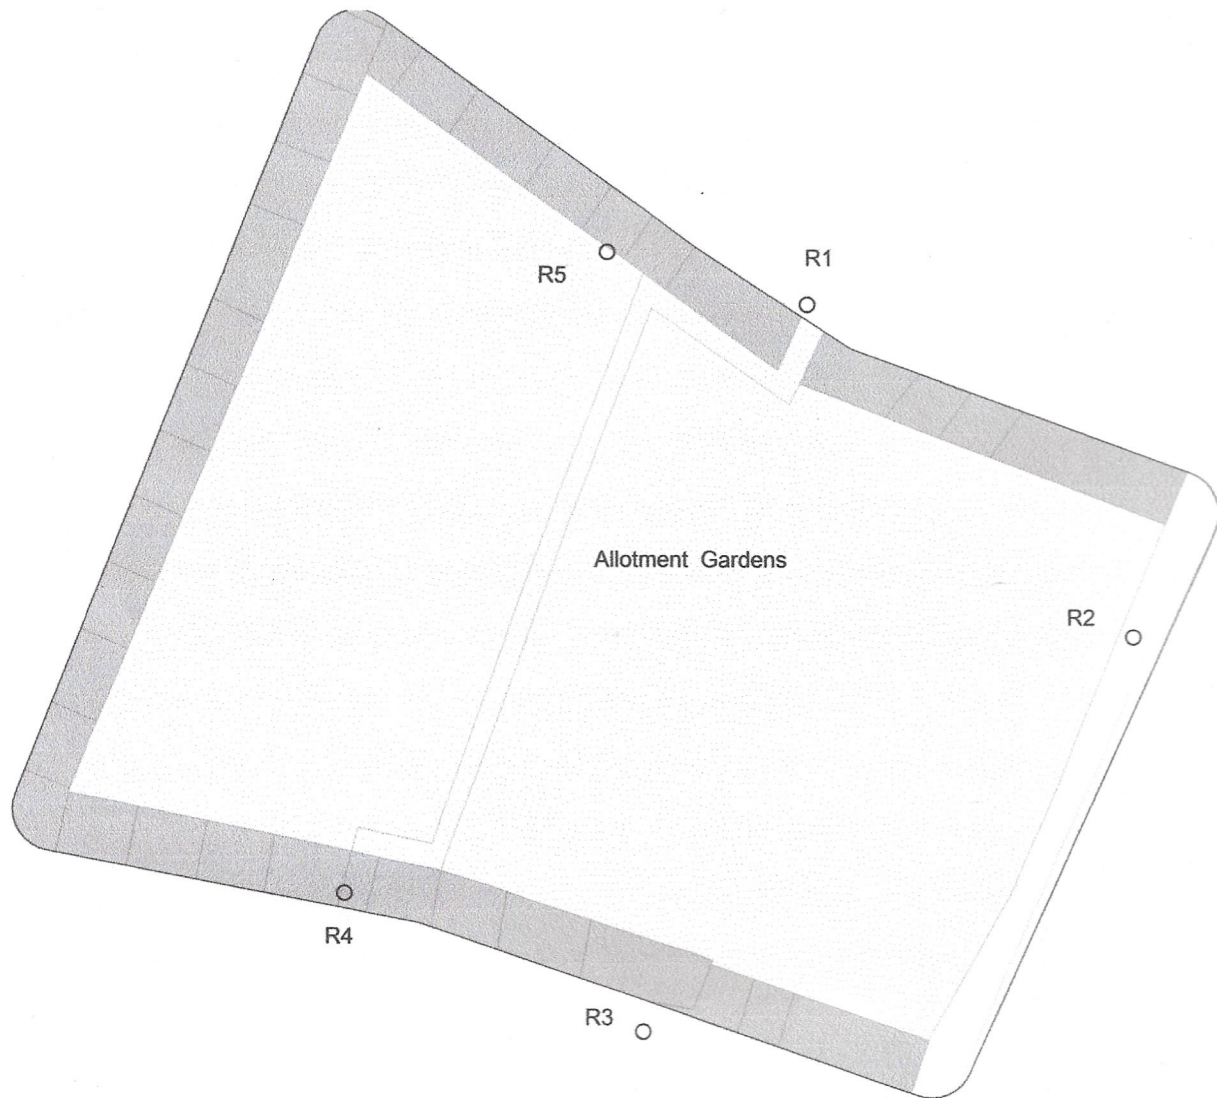

RAILWAY HILL ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
R1	Corkscrew Willow	Y	F	NWR. Tree is inside residential garden boundary and has been pollarded to approximately 7ft in height.		
R2	Sycamore	M	F	NWR. Multi-stemmed tree 75% covered in Ivy. Recommend banding Ivy to preserve the health of the tree.		
R3	Sycamore, Conifer, Pine (Group)	SM	F	All trees inside residential garden boundaries. Canopies over hang allotment plots and Ivy is present.		
R4	REMOVED					
R5	Cherry	Y	G	NWR. The lower branches have been crown lifted to provide a clearance for allotment.		

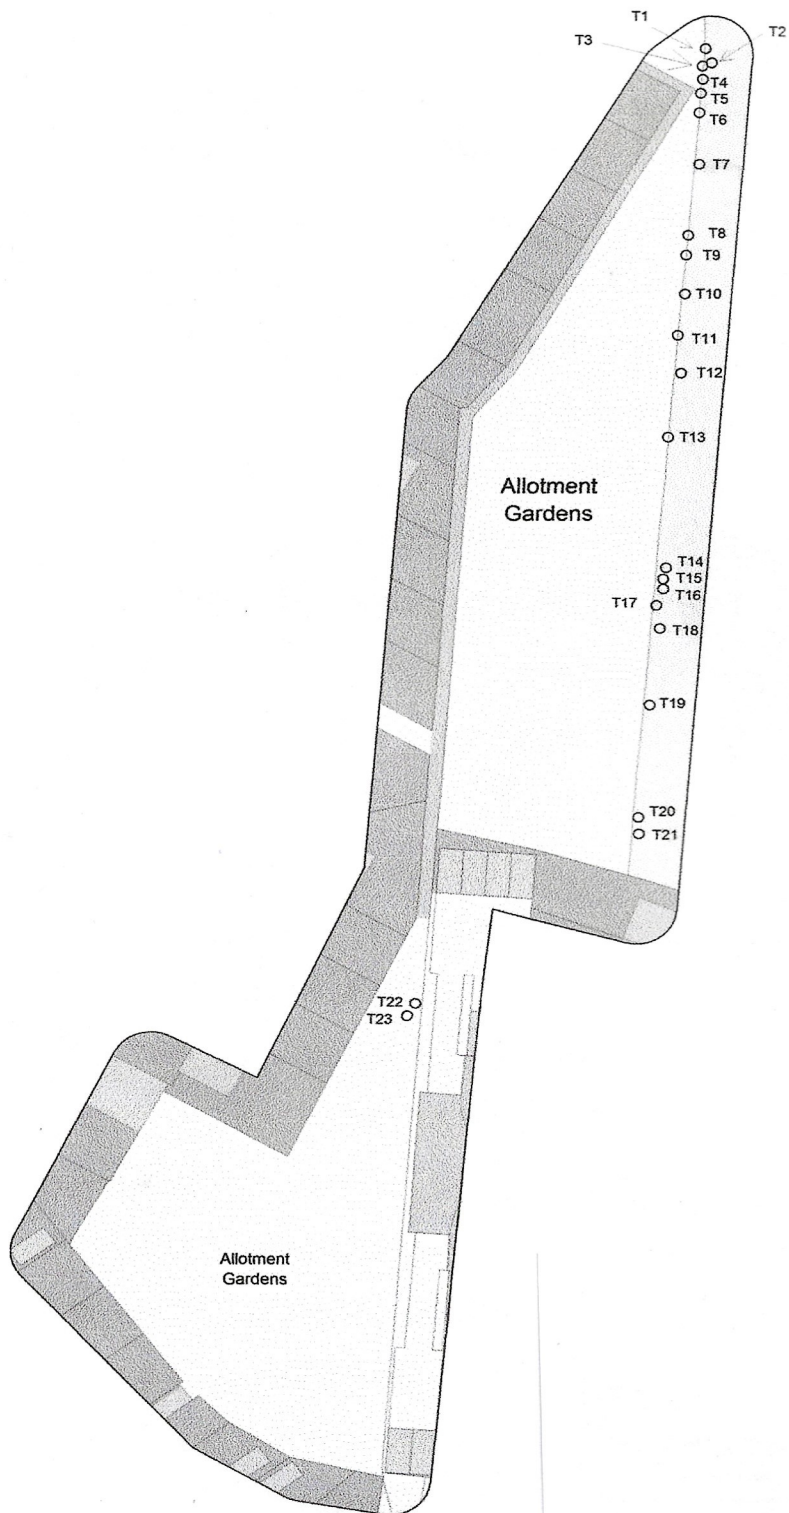

TAUNTON ROAD ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021


AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
T1	Oak	SM	F	NWR.		
T2	Scots Pine	SM	F	NWR. Trunk and canopy contains dead Ivy from banding.		
T3	Sycamore	SM	P	This tree is dead and should be removed.	A	£200
T4	Scots Pine	SM	F	NWR. This tree contains a lot of dead Ivy and pruning stubs. The weight distribution of the canopy is top heavy and should be monitored.		
T5	Oak	SM	G	NWR.		
T6	Oak	SM	G	NWR.		
T7	REMOVED					
T8	Sycamore	SM	G	NWR. Contains minor dead wood.		
T9	Sycamore	M	G	NWR. Weight distribution is uneven and leaning towards residencies. Monitor growth with a view to a potential height reduction when necessary.		
T10	X3 Scots Pine	SM	F,F,P	One of this group is dead and therefore should be removed.	A	£80
T11	Beech	SM	F	NWR.		
T12	Scots Pine	SM	G	NWR.		
T13	Scots Pine	SM	F	NWR. Covered with dead Ivy from previous banding at base.		
T14	Scots Pine	SM	F	NWR. This tree leans at an angle due to the light shading provided by the proximity of the Ash tree.		
T15	Ash	SM	F	NWR. Low lying canopy with signs of disease present in the leaves. Monitor health of tree.		
T16	Scots Pine	SM	F	NWR. Peeling bark and dead wood present.		
T17	Scots Pine	SM	F	NWR. Minor dead wood present, the top canopy section has grown at a 'kinked' angle due to light conditions. Monitor condition.		
T18	Scots Pine	SM	F	NWR. Misshapen trunk formation leaning towards allotments. Monitor condition.		
T19	Scots Pine	M	F	This tree is 90% enveloped by Ivy. Recommend banding to preserve tree.	B	

TAUNTON ROAD ALLOTMENTS -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature **SM** – Semi-mature **Y** – Young
CONDITION : **G** – Good **F** – Fair **P** – Poor **NWR** – No work required
PRIORITY: **A** – 2 months **B** – 18 months **C** – Within 2 years

T20	Beech	M	F	NWR. Ivy encroaching on tree.		
T21	Oak	M	F	NWR. Ivy encroaching on tree.		
T22	Holly	SM	G	NWR.		
T23	Cherry	SM	G	NWR. Over hangs shed.		

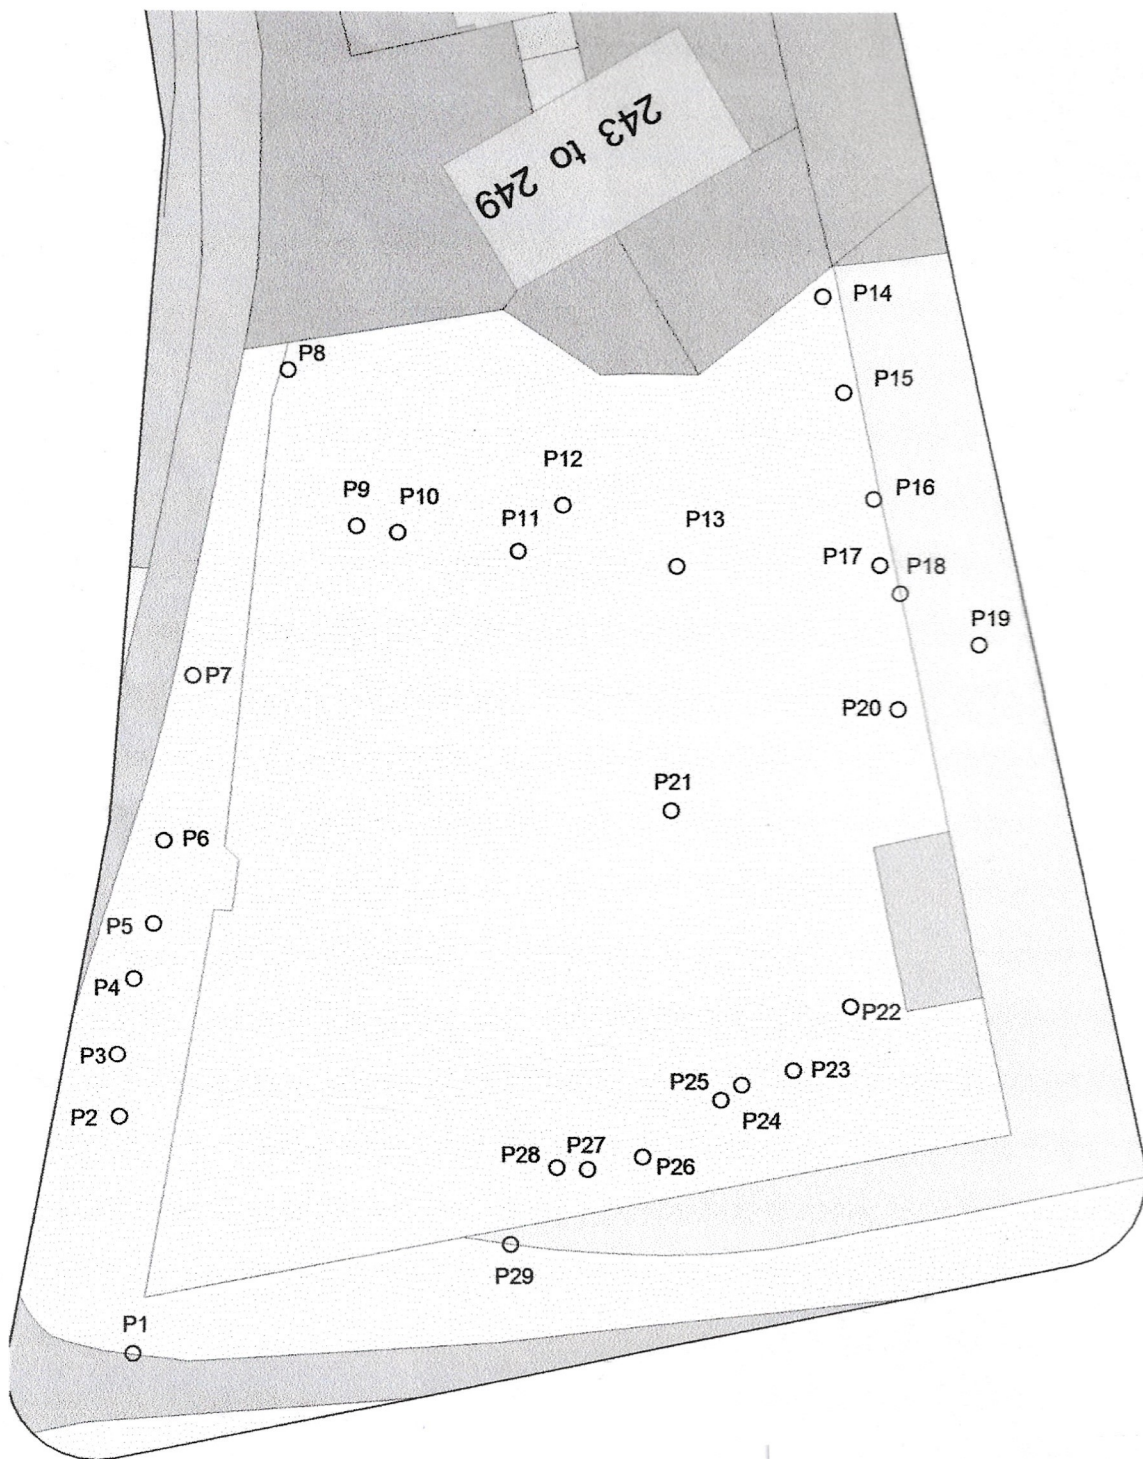

PEEWIT HILL -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

REF	SPECIES	AGE	CONDITION	OBSERVATIONS & RECOMMENDATIONS	PRIORITY	COST
P1	REMOVED					
P2	REMOVED					
P3	REMOVED					
P4	REMOVED					
P5	Hawthorn	SM	P	NWR. Sparse canopy due to shading by mature Sycamore. Beginning to over hang footpath. Recommend to monitor encroachment onto foot path.		
P6	Sycamore	M	F	NWR. Crossed limbs and branches present in canopy.		
P7	Sycamore	SM	F	NWR. Enveloped by Ivy, recommend banding of Ivy to preserve health of tree,		
P8	REMOVED					
P9	Sycamore	M	F	NWR. P9-P15 trees are Ivy covered, contain crossed branches and leaning trees. The area is very inaccessible and over grown. Recommend monitoring condition of trees.		
P10	Sycamore	M	F	NWR.		
P11	Sycamore	M	F	NWR.		
P12	Sycamore	M	F	NWR.		
P13	Sycamore	M	F	NWR.		
P14	Sycamore(double stemmed)	M	F	NWR. Slight over hang into residential gardens in upper canopy. Recommend to monitor extent of encroachment.		
P15	Sycamore	M	F	NWR.		
P16	Chestnut	M	F	NWR. Ivy and cavities present. Recommend to monitor condition of tree.		
P17	Lime	SM	F	NWR. Major dead wood present but due to position potentially does not pose a risk to the public.		
P18	Chestnut	SM	F	NWR. This tree has grown in a peculiar manner due to the presence of more dominant trees which limit the exposure to sunlight the tree receives.		

PEEWIT HILL -TREE CONDITION AND HAZARD ASSESSMENT carried out by ARROW TREE SERVICES LTD 2021

AGE CLASS: M – Mature SM – Semi-mature Y – Young
CONDITION : G – Good F – Fair P – Poor NWR – No work required
PRIORITY: A – 2 months B – 18 months C – Within 2 years

P19	Sycamore	SM	P	Totally covered in Ivy which has killed the tree. Area very inaccessible and over grown so potentially does not pose a risk if tree deteriorates further.		
P20	Sycamore	M	P	NWR. Tree has collapsed and is currently on the ground.		
P21	Sycamore	M	P	NWR. Tree has collapsed and is currently on the ground.		
P22	Sycamore	SM	F/P	NWR. Tree covered in Ivy, very inaccessible.		
P23	Sycamore	SM	F/P	NWR. Tree covered in Ivy, very inaccessible.		
P24	Sycamore	SM	F/P	NWR. Tree covered in Ivy, very inaccessible.		
P25	Chestnut	M	F	NWR. Tree growing from bank of ditch. Crossed limbs and dead wood present, very inaccessible.		
P26	Chestnut	M	F	NWR. Crossed limbs and dead wood present, very inaccessible.		
P27	Beech	M	P	This tree is 90% enveloped in Ivy. Recommend banding Ivy to preserve health of tree.		
P28	Chestnut	SM	F	This tree is 90% enveloped in Ivy. Recommend banding Ivy o preserve health of tree.		
P29	Black Poplar	SM	F	This tree leans heavily towards the foot path and McDonalds entrance. Recommend removal to avoid future potential problems.	A	£190